



## Products affected

Truck			Bus			Power Solutions			
4	PGRT	LPGRS	4	FKN	CK	P93	P96	E2011	PS2024
-	-	X	-	-	-	-	-	-	-

Miscellaneous:

## Fuel leakage from cover to fuel filter housing

### Background

The fuel filter housings for the XPI and PDE fuel systems sometimes leak when it is cold (-32°C or colder). More specifically, the leakage has been noted on the filter housing cover, which can cause the engine to be difficult to start.


### Service solution

Use the more cold-resistant O-rings on vehicles expected to be driven in extremely low temperatures (-32°C or colder).

### Renew the O-ring

#### 1. PDE engine:

The new PDE O-ring kit must be ordered together with the filter kit. During service, the O-rings from the filter kit must be discarded and the new O-ring 3 188 368 must be used instead.

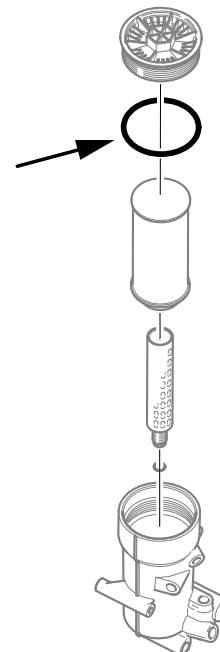


480 129



## 2. XPI engine:

The new XPI O-ring kit should be ordered together with the filter kit. During service, the O-rings from the filter kit must be discarded and the new O-ring kit 3 191 739 must be used instead.

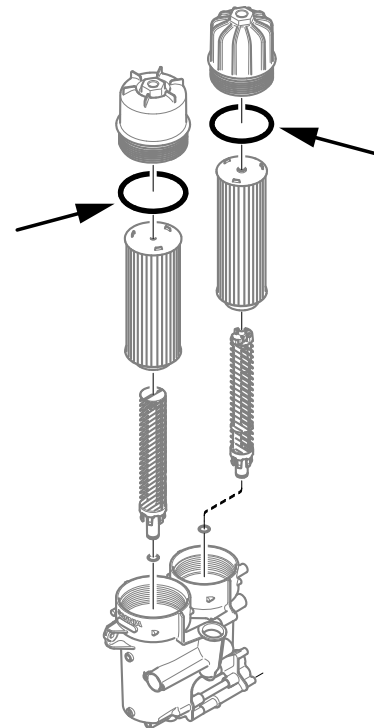

480 130

## Parts

Designation	Discontinued part	New part	Qty
O-ring	-	3 188 368	1
O-ring kit	-	3 191 739	1