


Code	Colour
BK	Black
BN	Brown
RD	Red
OG	Orange
YE	Yellow
GN	Green
BU	Blue
VT	Violet
GY	Grey
WH	White
PK	Pink

Des.	Pos.	Description
C41	E 10	Junction block
C1471/C334	F 6	Connector, 6-pole, POW, battery switch, ADR, RH battery
C1472/C334	F 6	Connector, 6-pole, POW, battery switch, ADR, LH
C1473/S40	F 5	Connector, 4-pole, POW, battery switch, RH battery
C1474/C405	F 7	Connector, 2-pole, POW, TCO, RH battery
C1475/C405	F 7	Connector, 2-pole, POW, TCO, LH beside C405
C1481/L101	E 7	Connector, 7p, VIS, rear comb lamp left
C1482/L102	E 5	Connector, 7p, VIS, rear comb lamp right
F1023	F 8	Fuse holder, 1-pole, POW, TCO, RH battery
G46	C 9	Ground, frame
L101	C 6	Rear combination lamp, left
L102	C 4	Rear combination lamp, right
P1.A	C 10	Battery
P1.B	C 10	Battery
R70	E 9	Relay, ADR, batt
S40	F 4	Switch, battery master switch



1) Temporary cables
2) Temporary connection

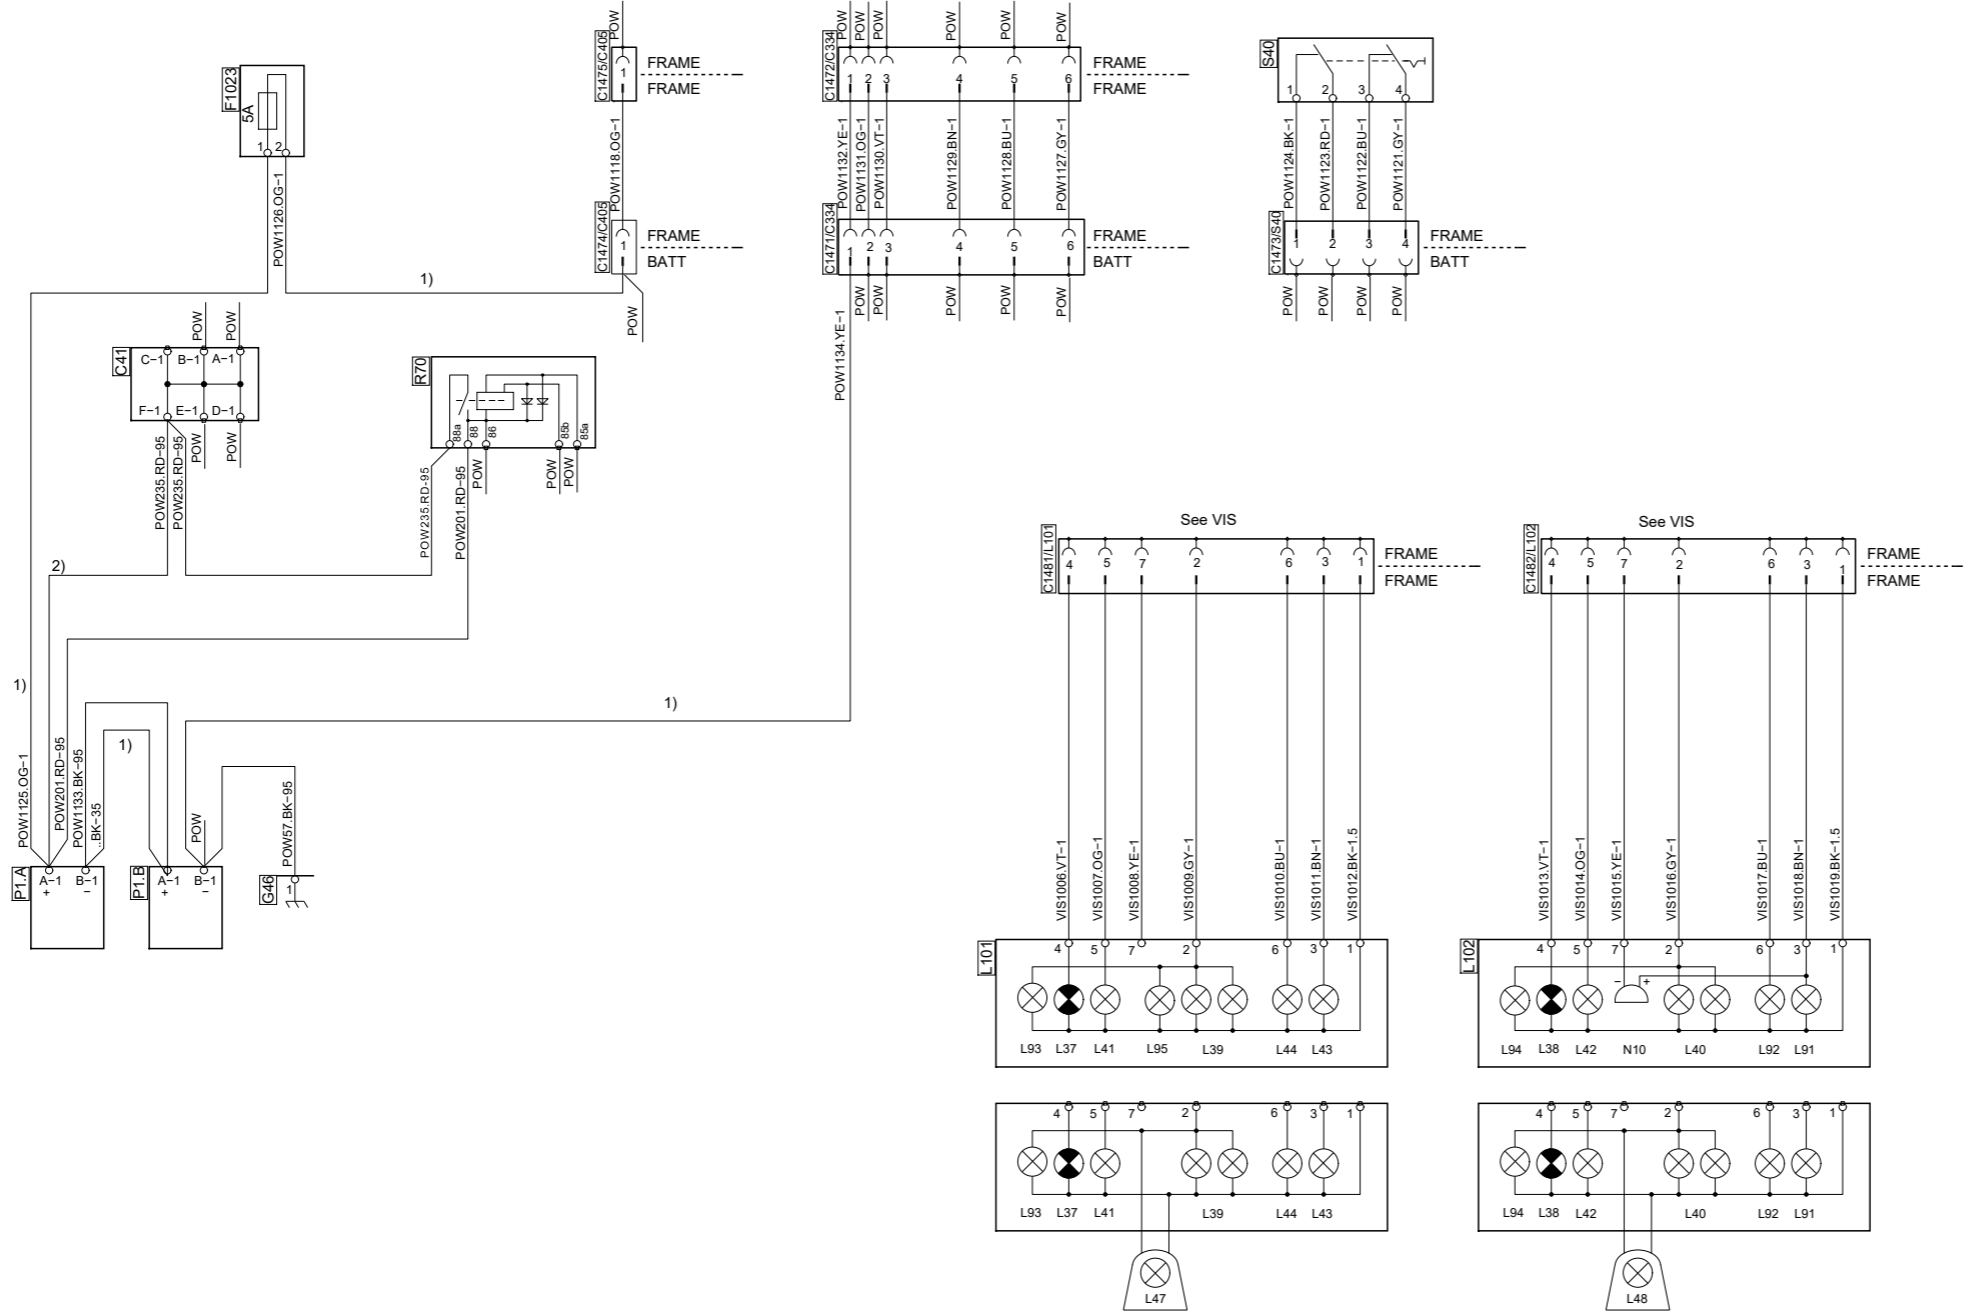

Circuit Diagram:
POW Nordic Tractor

Drawing No.-
Sheet-Rev: **1803077-1-4**

N.B. The copyright and ownership of this drawing including associated computer data are and will remain ours. They must not be copied, used or brought to the attention of any third party without prior permission (C) Scania, Sweden