
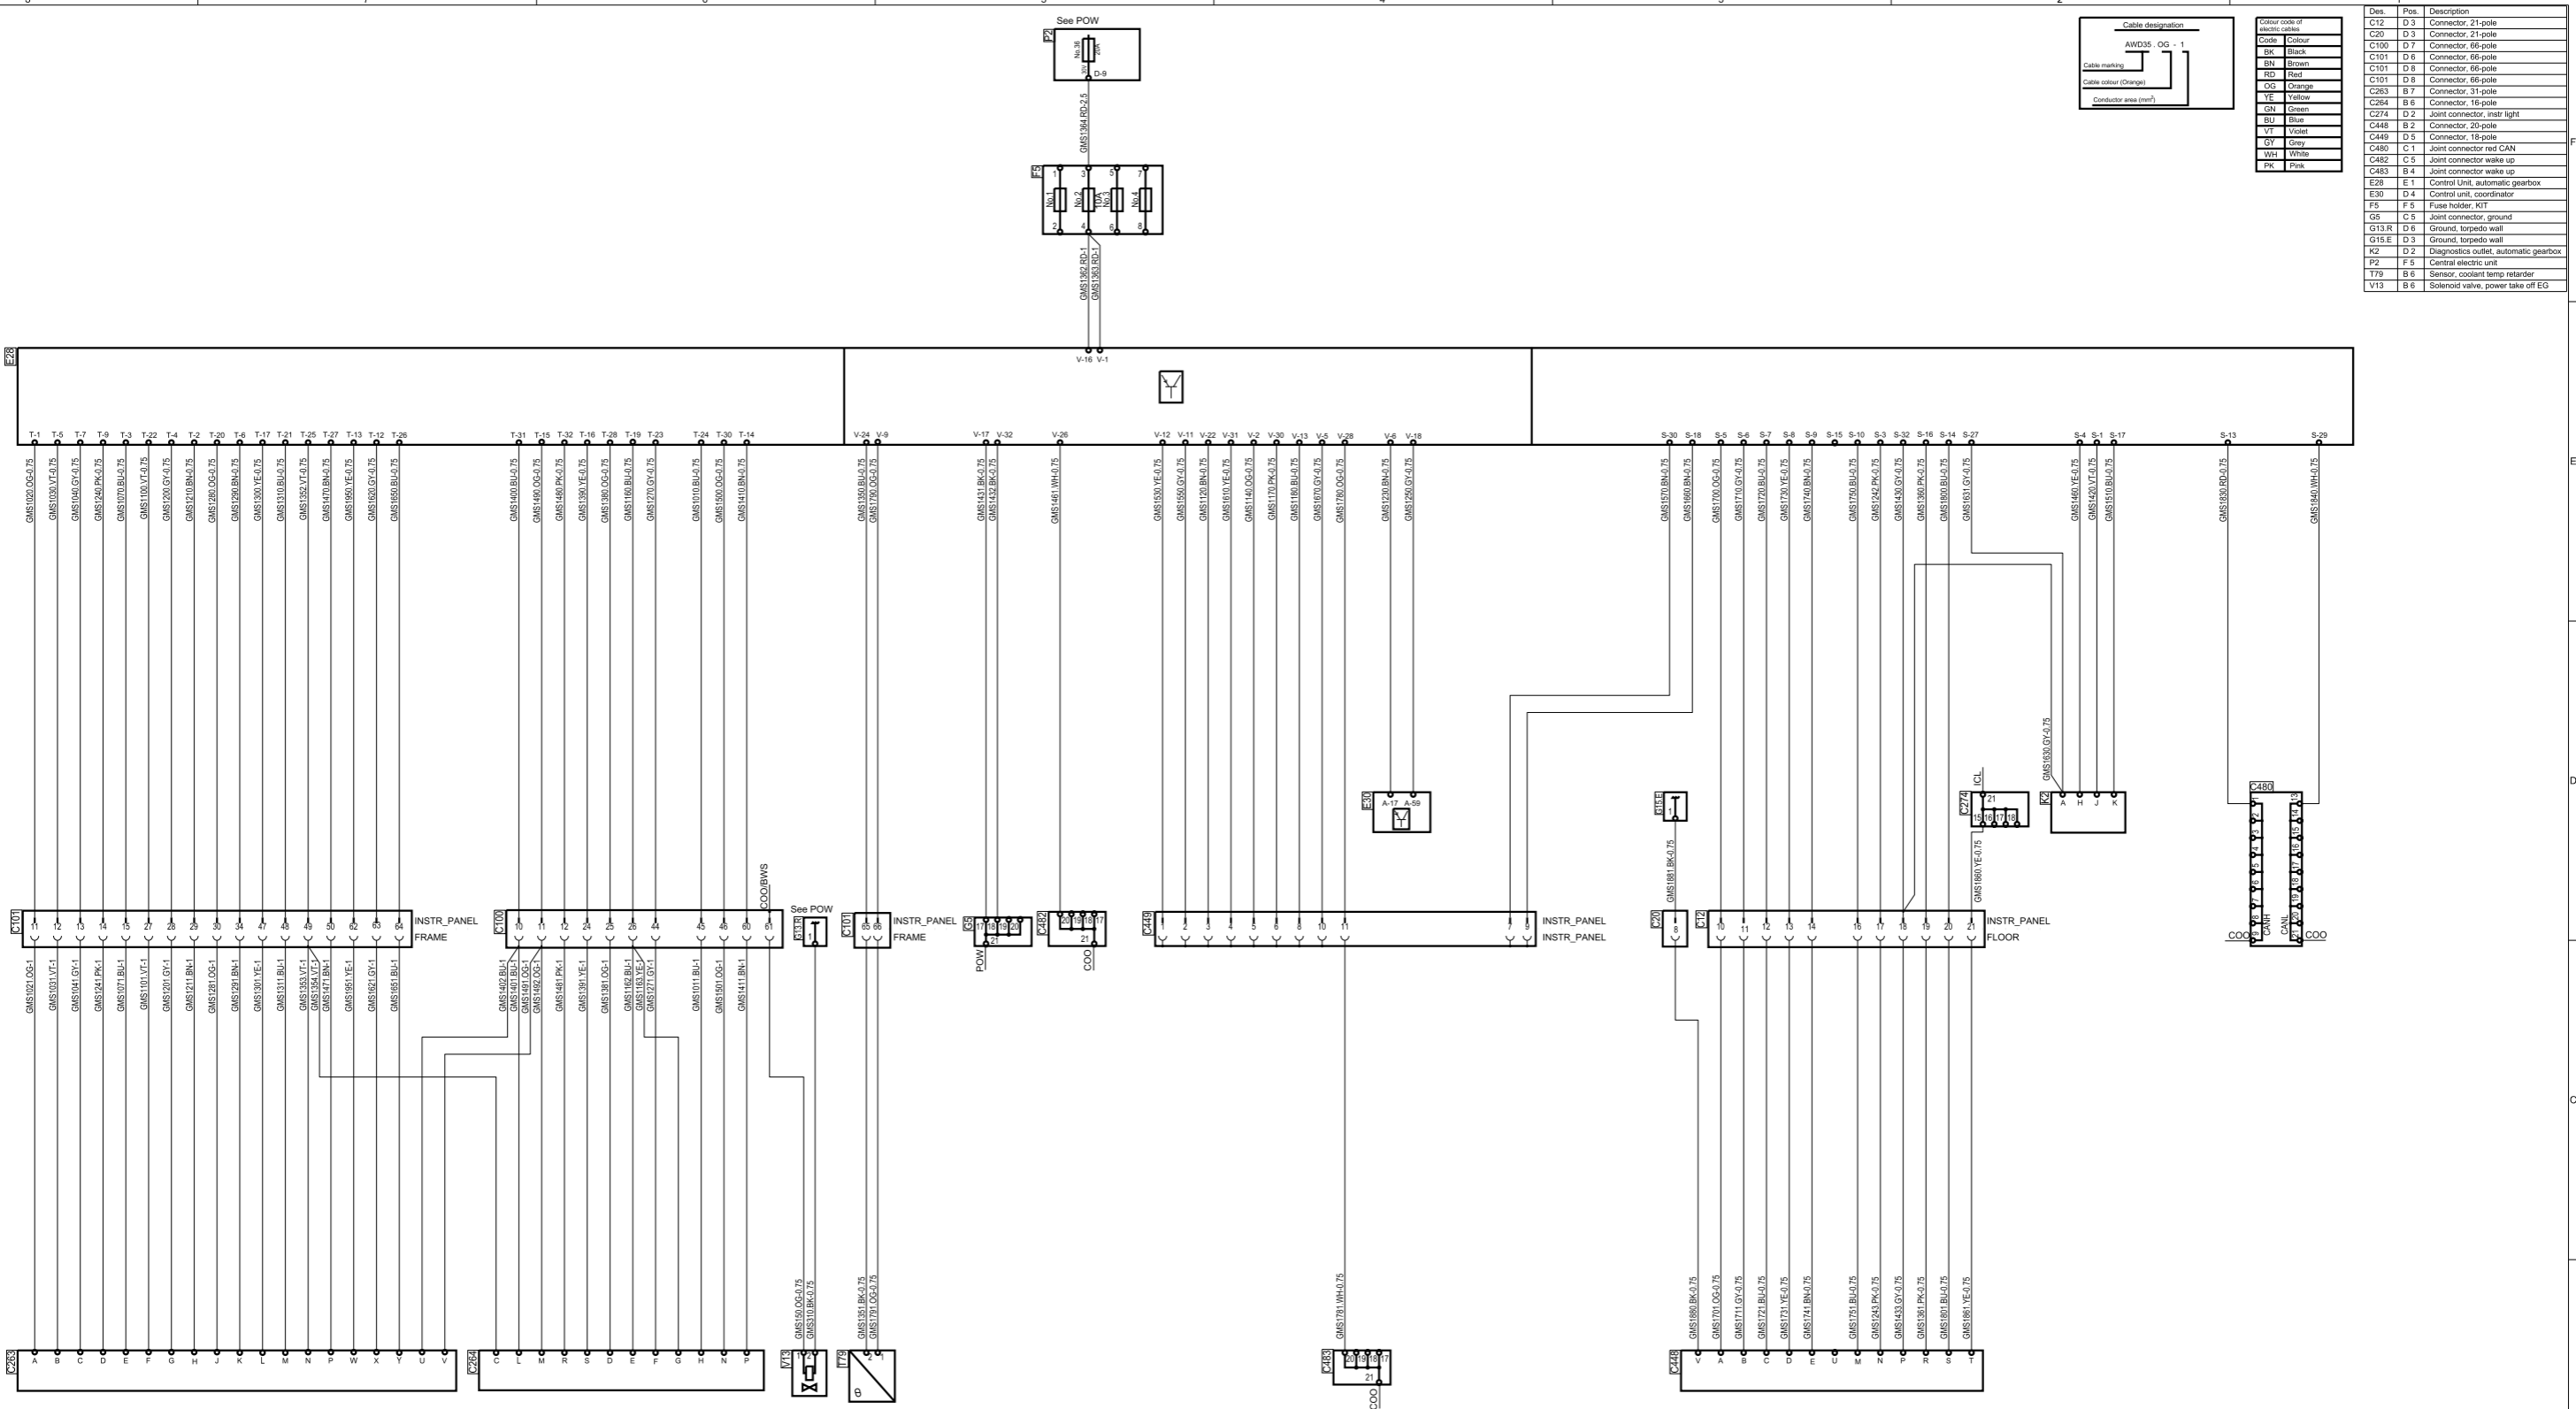


Des.	Pos.	Description
C12	D 3	Connector, 21-pole
C20	D 3	Connector, 21-pole
C100	D 7	Connector, 66-pole
C101	D 6	Connector, 66-pole
C101	D 8	Connector, 66-pole
C101	D 8	Connector, 66-pole
C283	B 7	Connector, 31-pole
C284	B 6	Connector, 16-pole
C274	D 2	Joint connector, instr light
C448	B 2	Connector, 28-pole
C449	D 5	Connector, 18-pole
C480	C 1	Joint connector red CAN
C482	C 5	Joint connector wake up
C483	B 4	Joint connector wake up
E30	E 1	Control Unit, automatic gearbox
E30	D 4	Control unit, coordinator
F5	F 5	Fuse holder, KIT
G8	C 5	Joint connector, ground
G13.E	D 6	Ground, torpedo wall
G15.E	D 3	Ground, torpedo wall
K2	D 2	Diagnostics outlet, automatic gearbox
P2	F 5	Central electric unit
T19	B 6	Sensor, coolant temp retarder
V13	B 6	Solenoid valve, power take off EG

Colour code of electric cables	Code	Colour
BR	Black	
BT	Brown	
RD	Red	
OG	Orange	
YE	Yellow	
GN	Green	
BU	Blue	
VT	Violet	
GY	Grey	
WH	White	
PK	Pink	



SCANIA

Circuit Diagram:

GMS GA

Drawing No.-
Sheet-Rev: **1499636-1-6**

N.B. The copyright and ownership of this drawing including associated computer data are and will remain ours. They must not be copied, used or brought to the attention of any third party without prior permission (C) Scania, Sweden

STD
4247