


Des	Pos	Description
C001	E 4	Connector 21 Pole Instrument Panel
C040	D 7	Connector 21 Pole Gearbox
E502	C 3	Control Unit Automatic gearbox ZF
E506	B 6	Automatic Gearbox ZF
G504	F 7	Join Connector 21 pole Grounding Electric Centre
K500	C 5	Diagnose Connector Automatic Gearbox ZF
P2	F 6	Central electric unit
T20	A 8	Sensor, tachograph
T505	B 6	Temperature Sensor Gearbox oil
V502	B 6	Solenoid valve activation of retarder memory
V503	B 6	Solenoid valve activation of retarder proportional

Cable designation		Colour code of electric cables	
AWD35_0G - 1		Code	Colour
Cable marking	Cable colour (change)	BN	Black
		BR	Brown
		RD	Red
		OG	Orange
		TE	Yellow
		GN	Green
		BL	Blue
		VT	Violet
		GR	Grey
		WH	White
PK	Pink		

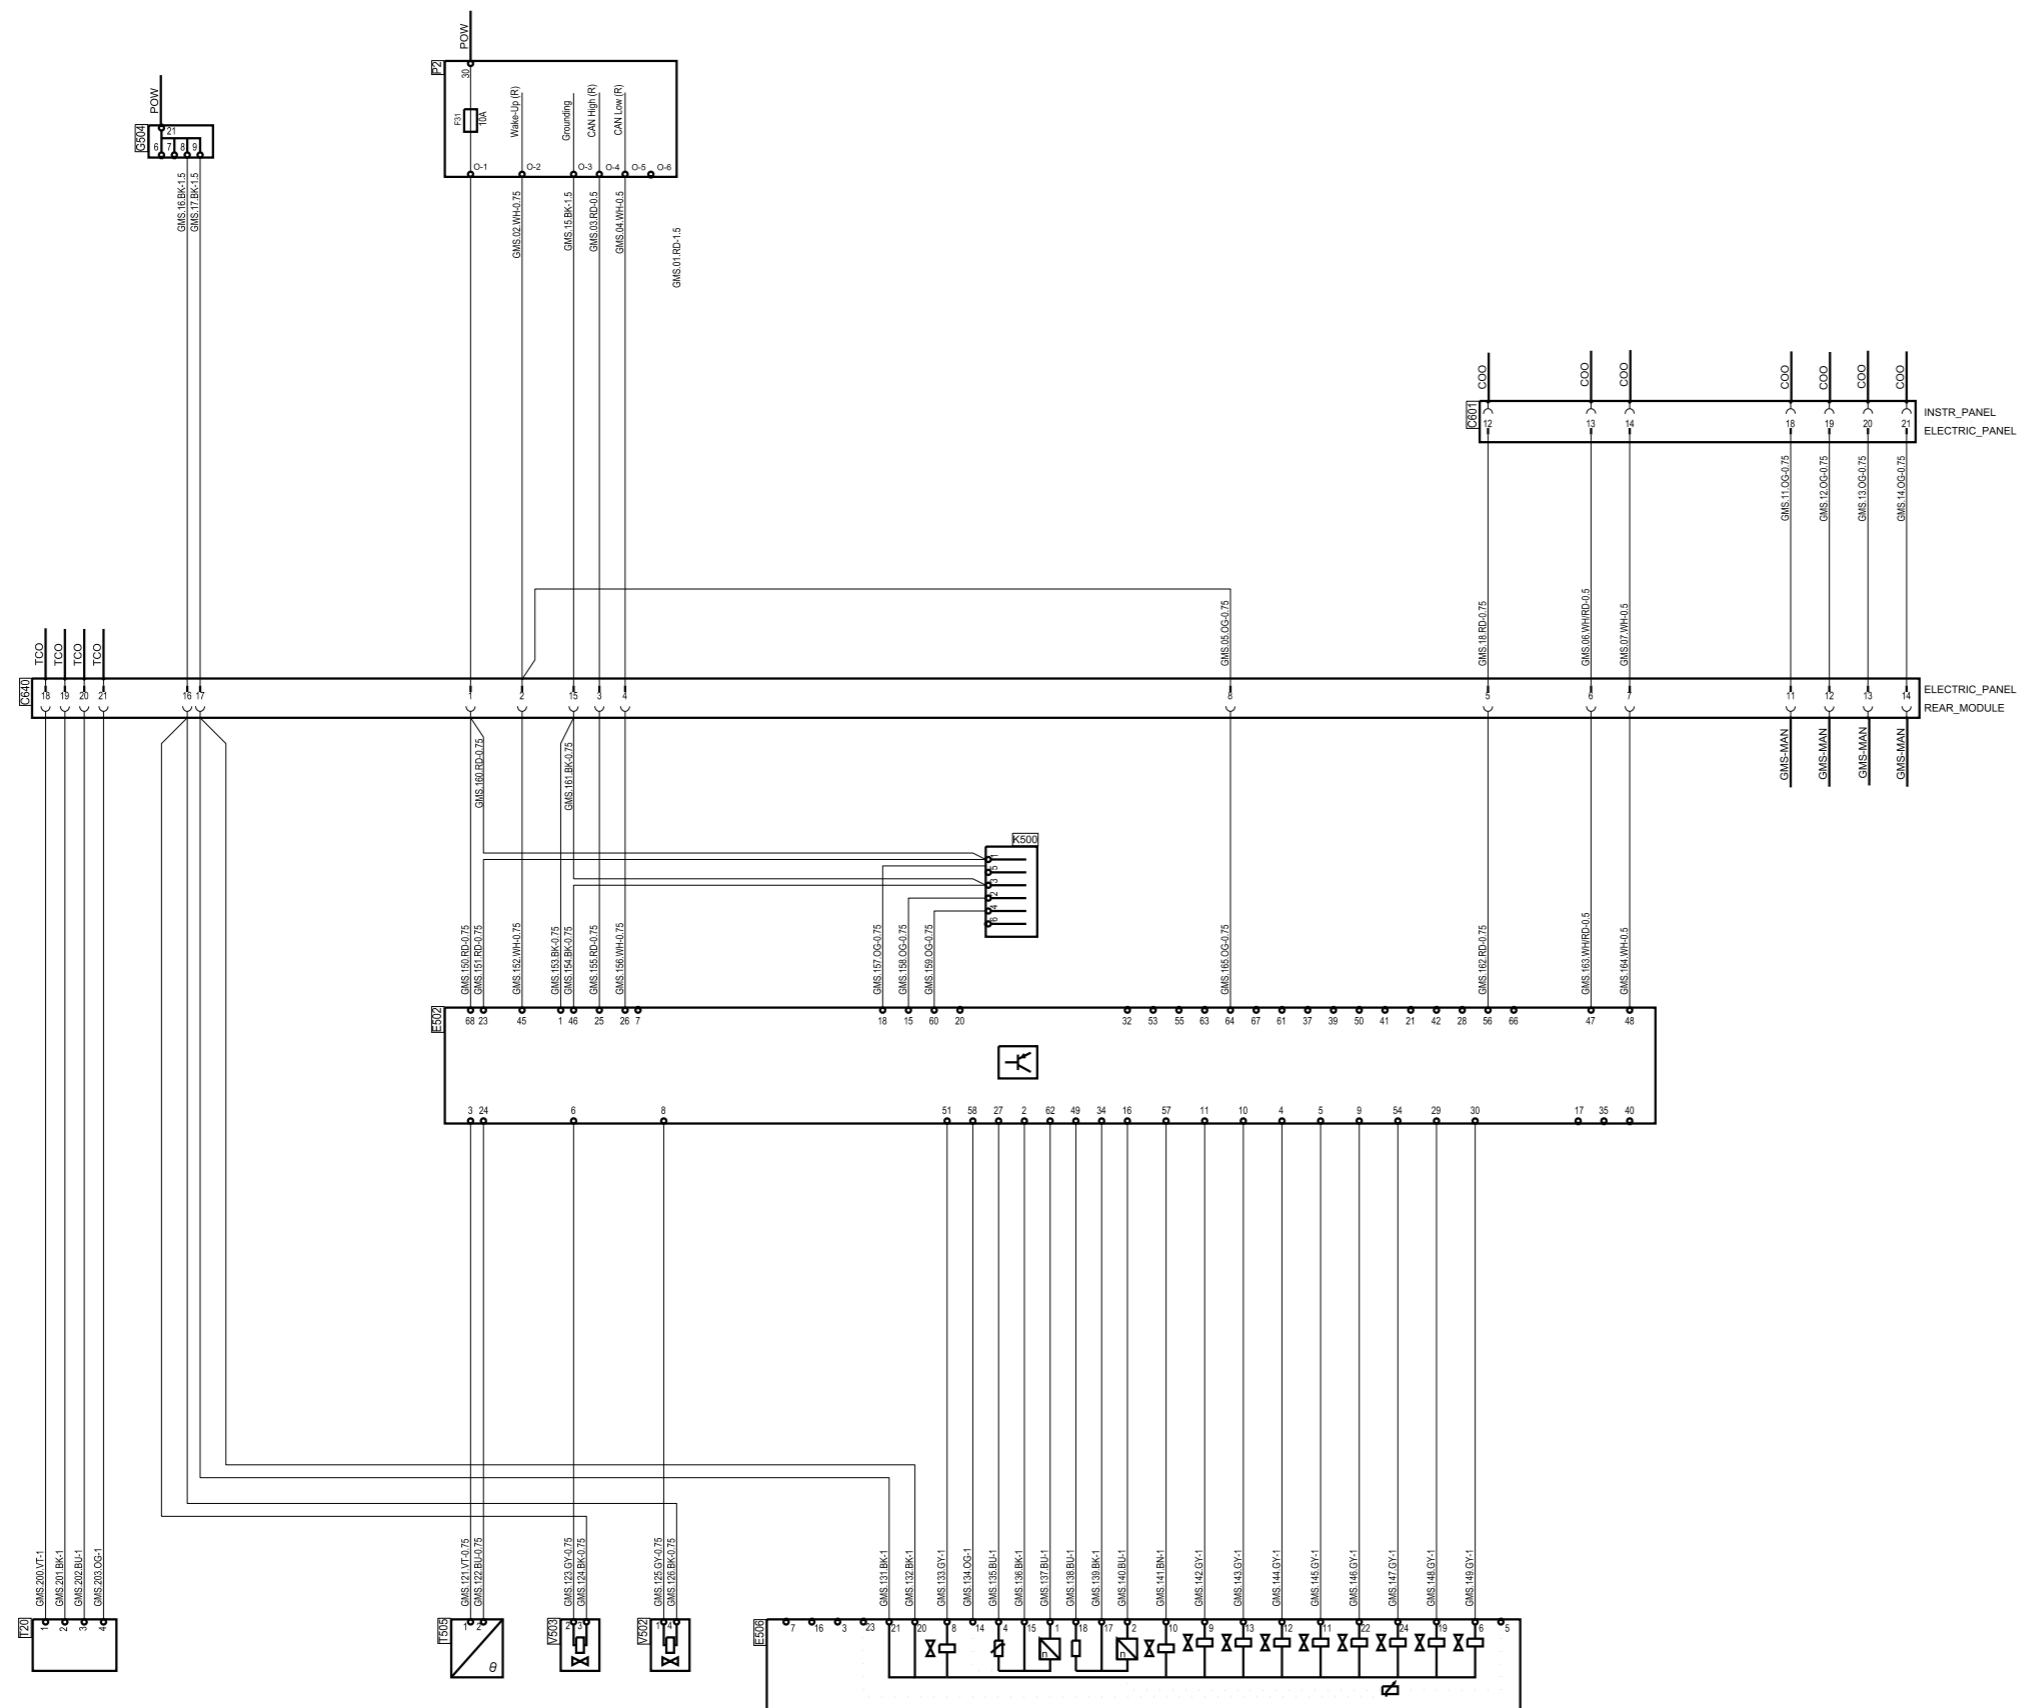

SCANIA

Circuit Diagram:

GMS ZF

Drawing No.-
Sheet-Rev: **1540010-1-5**

N.B. The copyright and ownership of this drawing including associated computer data are and will remain ours. They must not be copied, used or brought to the attention of any third party without prior permission (C) Scania, Sweden

STD
4247