


Des.	Pos.	Description
C26	B 4	Connector 21-pole
C91	B 6	Connector 21-pole
C101	B 6	Connector 66-pole
C102	B 7	Connector 66-pole
C219	B 4	Connector 21-pole
C419	C 6	Connector 3-pole
C1455	D 7	Connector 3-pole, AHS, beside C218
C1456	C 5	Connector 3-pole, AHS, beside C419
C1457	A 7	Connector 6-pole, AHS, beside C101
C1458	B 3	Connector 3-pole, AHS, fan, beside E17
C1459	D 4	Splice, AHS, ATA, beside D1062
C1461	D 4	Splice, AHS, ATA, beside D1062
C1462	D 4	Splice, AHS, ATA, beside D1061
C1463	C 4	Splice, AHS, ATA, beside D1060
C1464	C 4	Splice, AHS, ATA, beside D1060
C1465	B 4	Splice, AHS, ATA, beside D1063
C1466	B 3	Splice, AHS, ATA, beside D1064
C1467	B 3	Splice, AHS, ATA, beside D1064
D1060	C 4	Resistor, AHS, Fan, beside S3
D1061	D 4	Diode, AHS, heater upkeep, beside R1038, ADR
D1062	D 4	Diode, AHS, 15-supply, beside R1038, ADR
D1063	C 4	Diode, AHS, fan ATA, beside E17
D1064	B 3	Diode, AHS, fan E17, beside E17
F1022	E 4	Fuse holder, 4-pole, AHS, Aux ATA-heater, in P2
G3	C 6	Joint connector, ground
G8	A 5	Joint connector, ground
H1005	A 5	Heater, AHS, Aux ATA-heater, at position H13
K1004	E 6	Diagnostics outlet, ATA, behind P2
K1006	A 4	Control unit, ATA-heater, beneath C2
P2	F 6	Central electric unit
R1037	D 5	Relay, AHS, Circle pump WTA-heater, in P2
R1038	D 4	Relay, AHS, heater upkeep, in P2, ADR
R1039	D 4	Relay, AHS, fan, in P2
Y1032	A 6	Pump, AHS, ATA, fuel metering pump, LH beam

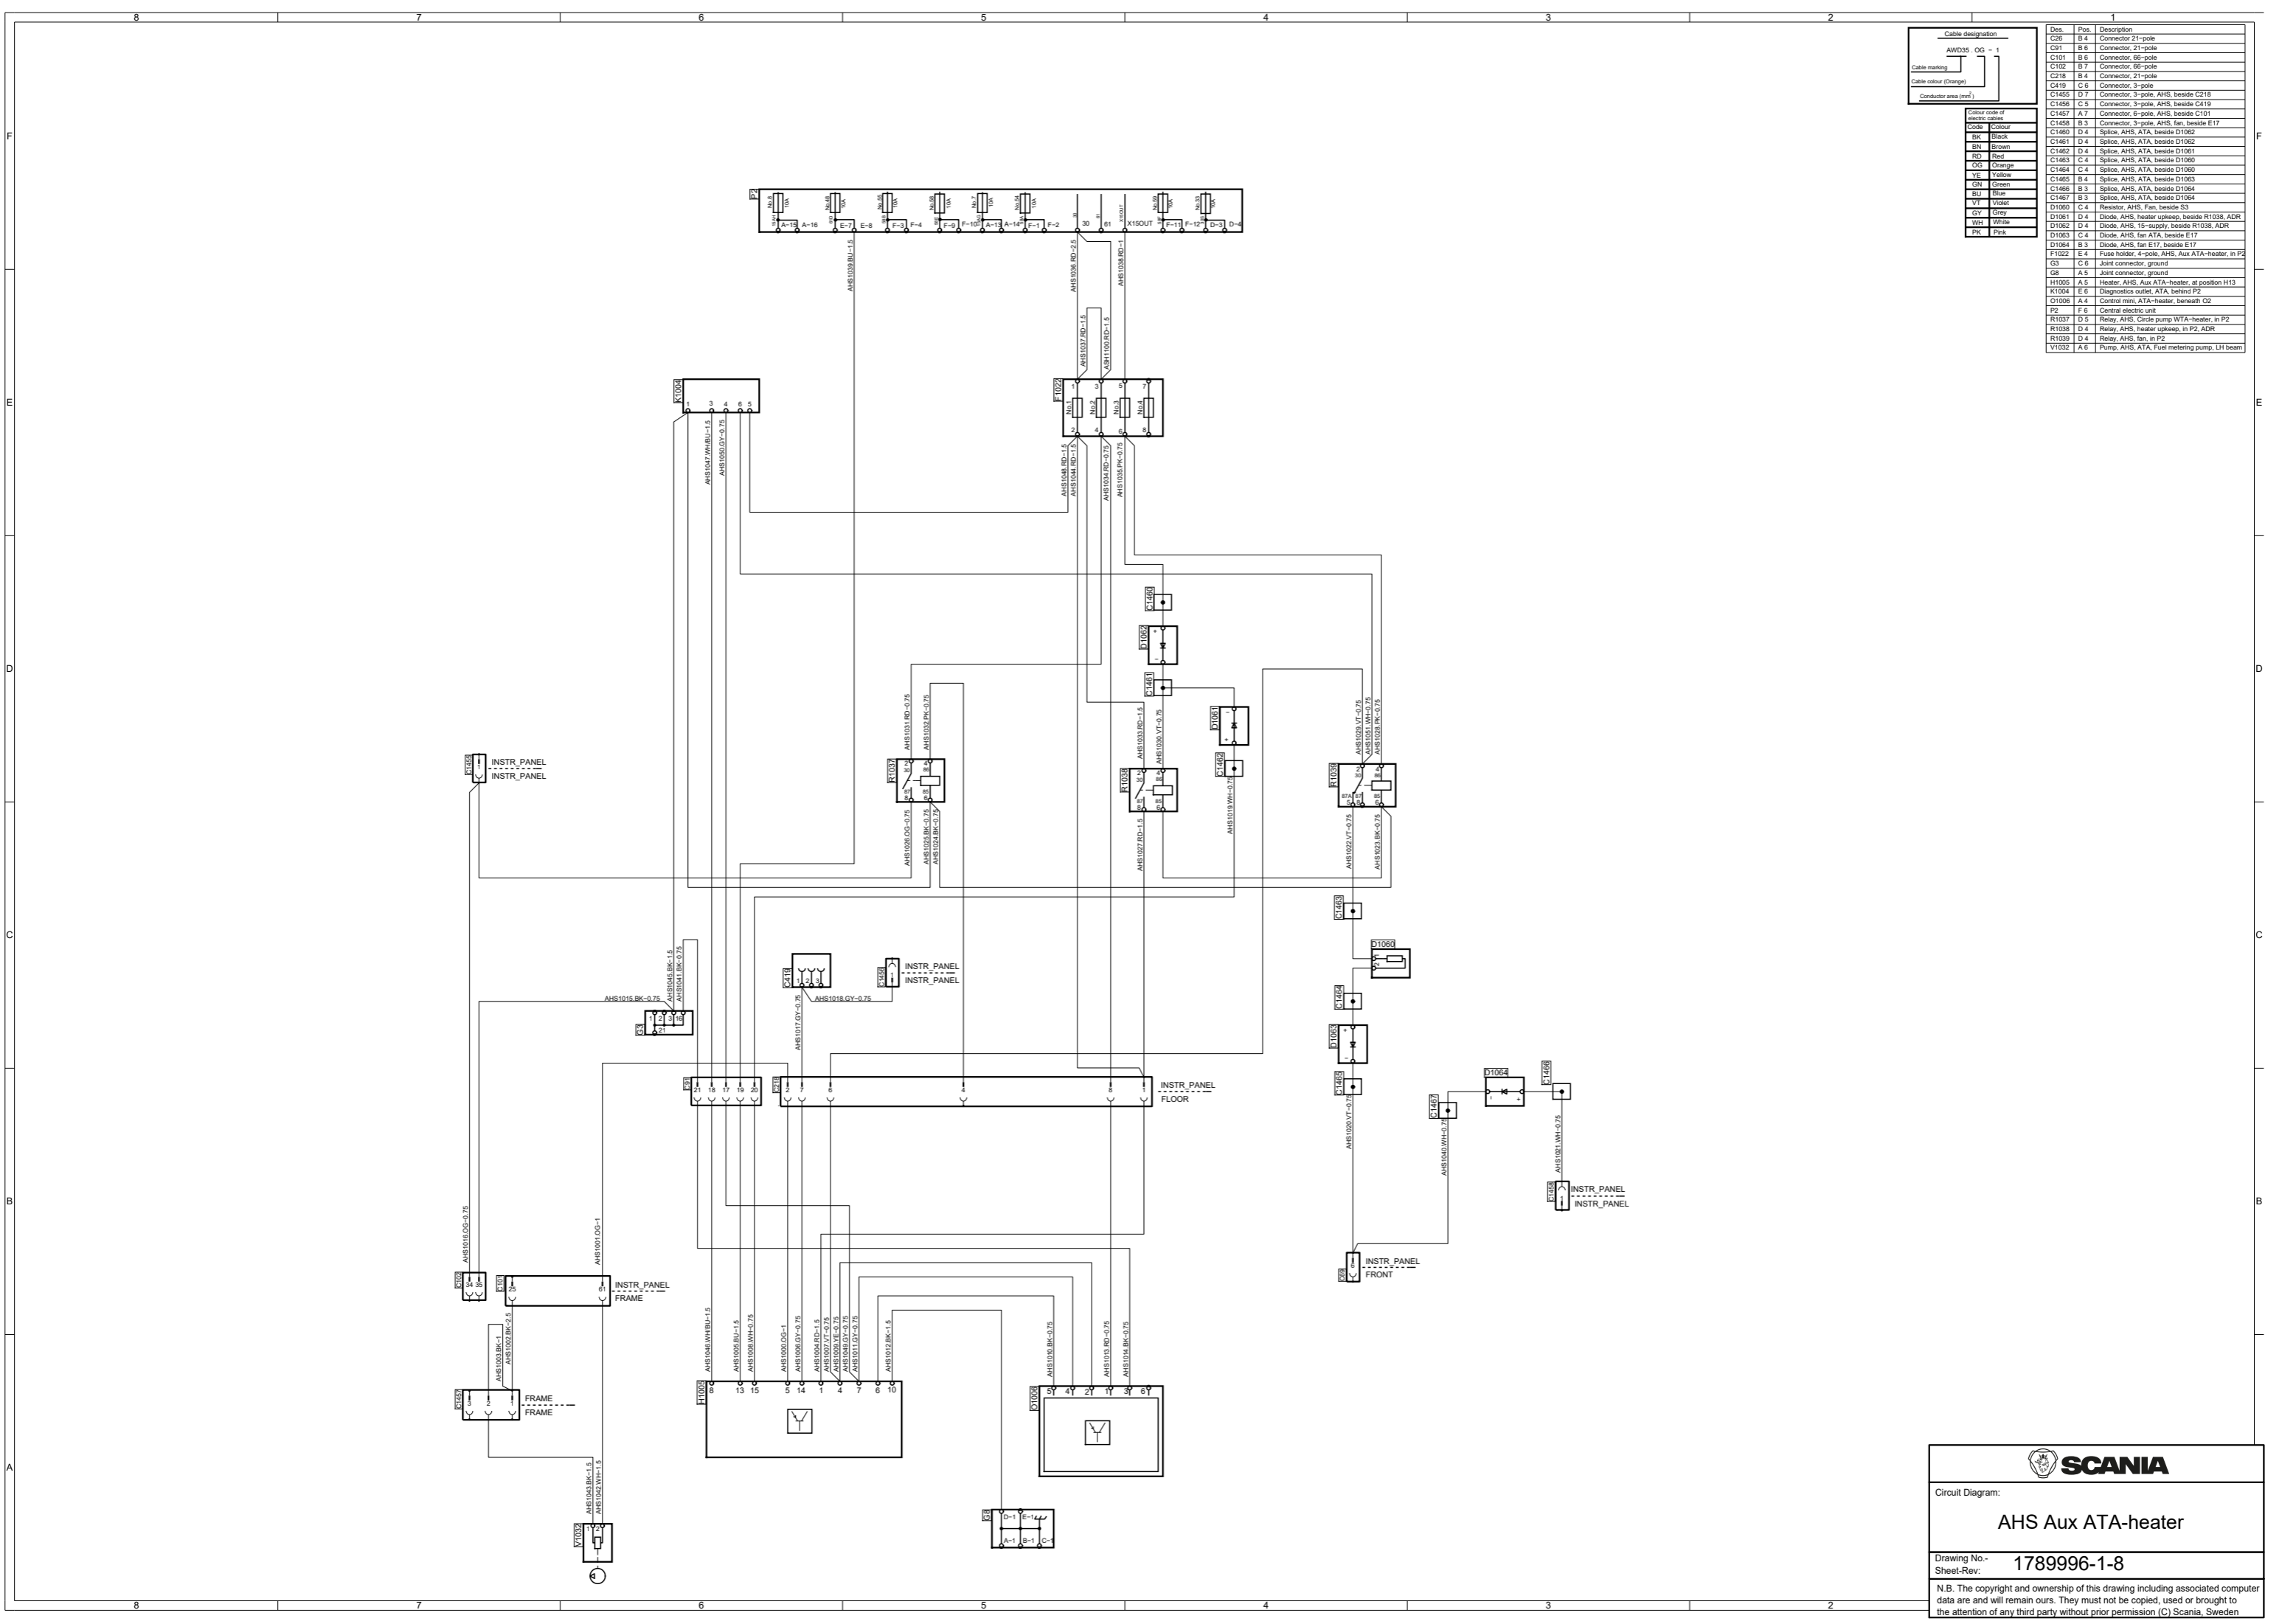

SCANIA

Circuit Diagram:
AHS Aux ATA-heater

Drawing No.-
Sheet-Rev: **1789996-1-8**

N.B. The copyright and ownership of this drawing including associated computer data are and will remain ours. They must not be copied, used or brought to the attention of any third party without prior permission (C) Scania, Sweden